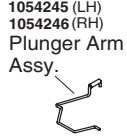
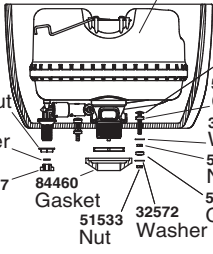


SYMPTOMS	CORRECTIVE ACTION	PARTIAL SERVICE PARTS
1. Poor Flush	A. Clean under the bowl rim. B. Plunge the bowl, auger trap, and auger drain to clear blockage C. Adjust the gap between the actuator and plunger arm to approximately 1/8" (3 mm). D. Fully open the supply stop. E. Clean the screen with a medium to hard bristle brush. Replace the screen if necessary. Phone 1-800-533-3450 for assistance. F. Refer to the installer/dealer for assistance.	 <p>1054245 (LH) 1054246 (RH) Plunger Arm Assy.</p> <p>78132 Trip Lever Nut</p> <p>1045276** (LH) 1045277** (RH) Trip Lever</p> <p><i>For service on the Sloan vessel, phone 1-800-533-3450.</i></p>
2. No Flush	A. Fully open the supply stop. B. Tighten the nut. Turn the nut counterclockwise. C. Hook the plunger arm over the trip arm. D. Clean the screen. Retain the screen if necessary. Phone 1-800-533-3450 for assistance. E. Replace the inlet components. Phone 1-800-533-3450 for assistance.	 <p>84464 Locknut 42398 Washer</p> <p>51624 Bolt 51743 Gasket 32572 Washer 51533 Nut 51743 Gasket 32572 Washer</p>
3. Bowl water continues to flow or tank fill water will not shut off.	A. Adjust gap between actuator and plunger arm to approximately 1/8" (3 mm). B. Repair or replace plunger arm (refer to installer/dealer for assistance). C. Replace the lower supply group.	<p>42397 Nut 84460 Gasket 51533 Nut</p>
WARNING: Use only genuine parts as shown to avoid property damage.		**Finish/color code required.
If unable to correct the problem, contact Customer Service: 1-800-4-KOHLER (USA), 1-800-964-5590 (Canada), or www.kohler.com.		